Autonics

SCALING METER M4NS/M4YS SERIES

М U Ν



Thank you very much for selecting Autonics products.

For your safety, please read the following before using.

Caution for your safety

*Please keep these instructions and review them before using this unit. ※Please observe the cautions that follow;

∆Warning Serious injury may result if instructions are not followed.

△Caution Product may be damaged, or injury may result if instructions are not follow

*The following is an explanation of the symbols used in the operation manual. Acaution: Injury or danger may occur under special conditions

⚠ Caution

1. In case of using this unit with machineries(Nuclear power control, medical equipment, vehicle, train, airplane, combustion apparatus, entertainment or safety device etc), it requires installing fail-safe device, or contact us for information on type required.


Marning Marning

- 1. It must be mounted on panel.
- 2. Do not repair, check up or connect when power on and measuring input applied.
- It may give an electric shock.


 3. Do not disassemble and modify this unit, when it requires. If needs, please
- It may give an electric shock and cause a fire.
- 4. This unit shall not be used outdoors.
- It might shorten the life cycle of the product or give an electric shock.


 5. Please observe specification rating.
 It might shorten the life cycle of the product and cause a fire.
- 6. Be sure that there is not insulated between measuring input terminal and power
- t may cause mechanical trouble of measuring target or result in product damage
- 7. Please wire properly after check polarity of power.
- may cause a fire or explosion and result in product damage 8. In cleaning the unit, do not use water or an oil-based detergent.
- It might cause an electric shock or fire that will result in damage to this product.

 9. Do not use this unit at place where there are flammable or explosive gas, humidity, direct ray the sun, radiant heat, vibration, impact etc.
- 10. Do not inflow dust or wire dregs into inside of this unit.
- 11. Please connect properly after checking the polarity of measuring terminals.

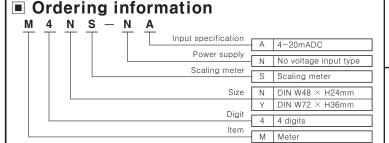

Front panel identification





1 Display value Parameter Error display

2 MD Key: When enter into Parameter group, return to RUN mode,


After completing Parameter setting.

- (Up) key: When enter into the status of Parameter setting
- (Move) key: When enter into the status of Parameter setting and move Digit
- *The above specification are changeable without notice anytime.

Specifications

Model		M4NS-NA	M4YS-NA	
Power sup	ply	No voltage type		
Power co	nsumption			
Display method		7Segment LED Display(4digit)		
Display accuracy		(Note1) 0.3% full scale of ±1Digit		
Display cycle		Selectable 0.5sec/1sec/2sec/3sec/4sec/5sec		
Resolution		12,000 resolution		
Max. display		-1999 to 9999		
Setting type		Front S/W key		
Input		4-20mADC		
Self-diag	nosis function	Error display function(HHHH/LLLL)		
Insulation resistance		Min. 100M Ω (500VDC) between external terminal and case		
Dielectric strength		2000VAC for 1 minute between external terminal and case		
Vibration	Mechanical		0.75mm amplitude at frequency of 10 to 55Hz in each of X, Y, Z directions for 1hour	
Vibration	Malfunction	0.5mm amplitude at frequency of 10 to 55Hz in each of X, Y, Z directions for 10minute		
Shock	Mechanical	300m/s ² (30G) in X, Y, Z directions for 3 times		
SHOCK	Malfunction	100m/s ² (10G) in X, Y, Z directions for 3 times		
Ambient temperature		-10 to 50℃(at non-freezing status)		
Storage temperature		-25 to 66℃(at non-freezing status)		
Ambient humidity		35 to 85%RH		
Weight		Approx. 46g	Approx. 88g	

Dimensions

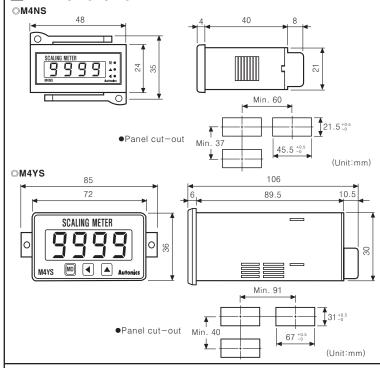


Connections




Prescale function

This function is to display the value with setting certain Hi/Low limit value against 4-20mADC input. For example If set a=4mADC, b=20mADC and A,B as display value, it will be displayed a=A, b=B.

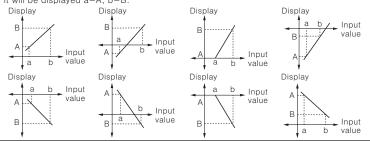

■ Decimal point setting function[dot]

This function is to set the decimal point position of display value (Set in Parameter setting group)



Correction function

(Parameter group : I nb.H/I nb.L mode)

This function is to adjust the error of display value after calculating scale value for measuring input and also correct the input error of sensor etc.

I nb.L: -100 to 100 [Adjust deviation of Low value],

I nb.H: 0.900 to 1.100 [Correct gradient(%) of High value]

Ex)When display value is 0.0 to 500.0 against 4-20mA input, if the display value is "1.2" for 4mA input, set -12(Ignore the decimal point) as I nbL value to display "0.0" So enable to remove offset of Low display value.


*When completed above Low value setting then apply 20mA, if the display value is "500.5, the correction value will be 0.999(5005/5000=0.999), set 0.999 as I nbH value then enable to correct High value (50005 \times 0.999 = 5000) Ignore the decimal point.

Monitoring mode for Peak display value

This function is to monitor Max. value and Min.value by current display value then display its Data in PELH mode and PELL mode.

Enable to set delay time in PELL mode to protect the wrong Data by initial over current and settable from 0 to 30sec. and start to monitor after delay time.

- Pressing MD key to enter Monitoring mode in RUN mode.
 Each Peak value will be shown by pressing 4 key in Monitoring mode and Peak value will be initialized by pressing <a> once more.
- 3. If no key touched for 60sec., it will return to RUN mode
- 4. When do not use Monitoring function, set **00 5** for **PELL** in Parameter setting.

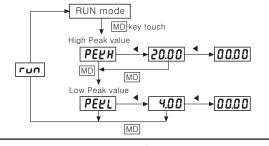

Display cycle delay function

It is difficult to display when the measuring input value is fluctuating. In this case it is able to make display value stable by delaying display cycle. Display cycle can be changed in **d15.** mode of Parameter 2(Selectable 0.5s/1.0s/2.0s/3.0s/4.0s/5.0s). If select 5.0S, it will be the measuring input value on an average for 5sec., then display it every 5sec

Error Display function

- ①When LLLL flickers

I)Input current is lower than 3% in 4-20mADC(16mA scale)

LLL will flicker when it is under 3.52mA [16mA×3%=0.48mA] →

4mA-0.48mA=3.52mA 2) When it is beyond Min. display value(-1999) [by display value] ②When HHHH flickers

1)Input current is higher than 3% in 4-20mADC(16mA scale)

HHHH flickers [$16\text{mA} \times 3\% = 0.48\text{mA}$] $\rightarrow 20\text{mA} + 0.48\text{mA} = 20.48\text{mA}$. When it is higher than 20.48mA.

2) When it is beyond Max. display value (9999) [by display value]

2 Turn Error display off

LLLL and HHHH are displayed when input is out of measuring range, therefore it will be disappeared automatically when input returns to measuring range 3. Error setting and sort

It will display the error message according to the setting value which set % value against analog input range and set it in **E.P[L**]mode by **4/A** key.


E.PCL O	LLLL/HHHHH are displayed when it is over 0% out of 4-20mADC range
	LLLL/HHHHH are displayed when it is over 1% out of 4-20mADC range
E.PCE 2	LLLL/HHHHH are displayed when it is over 2% out of 4-20mADC range
E.PCL 3	LLLL/HHHHH are displayed when it is over 3% out of 4-20mADC range
E.PCL 4	L-SC / H-SC are displayed always when it is out of 4-20mADC range

**Caution: LLLL / HHHH will not be displayed when the differences are under 100 between L-5C and H-5C.

Parameter

- 1						
	Display		Function	Setting range		
	L-5[Low Scale	Low limit display value for 4mA input	-1.999 to 9.999 -19.99 to 99.99 -199.9 to 999.9 -1999 to 9999		
	H-5[High Scale	Hi limit display value for 20mA input			
	dot	Dot	Set Dot position			
	I nb.L		Correct Low-limit value of display value.	-100 to 100		
	I nb.H		Correct High-limit value of display value(%).	0.900 to 1.100		
	PEY.E	Peak Time	Set monitoring delay time	0 to 30sec		
	d 1 5.E	Display time	Selectable sampling time(sec)	Selectable 0.5/1.0/2.0 /3.0/4.0/5.0		
	E.PCŁ	Error %	HHHH/LLLL display value range for input	Selectable 0 to 3% or (4:Fixed H-SC/L-SC)		
	LoC	Lock	Set lock function	Selectable ON, OFF		
			·	·		

Parameter setting

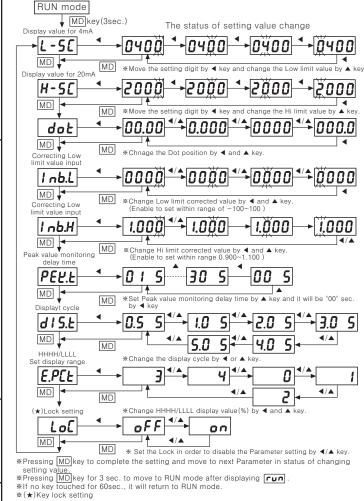

Toff: Disable to change or set Parameter


on: Disable to change or set Parameter but enable to check the setting value in Parameter group. Disable to enter into the status of change setting value by pressing ◀/▲.

Factory specification

Parameter	Parameter display	Factory specification
Low limit display value for 4mA input	L-5[0400
Hi limit display value for 20mA input	H-5[2000
Set Dot position	dot	0 0.0 0
Correction of Low limit value input	I nb.L	0000
Correction of Hi limit value input	I nb.H	1.000
Peak value monitoring delay time	PEY.F	015
Display cycle	d 1 5.Ł	0.5 5
Set % of HHHH/LLLL display range	E.PCŁ	3
Lock setting	LoC	oFF

Caution for using

- . Please use separated line from high voltage line or power line in order to avoid inductive Please install power switch or circuit breaker in order to cut the power supply.
- The switch or circuit breaker should be installed near by users for safety.
 Be sure to avoid using this unit near by machinery makes strong high frequency noise.
- (Welding machine, high capacity SCR unit etc.)
 Input line: Shield wire must be used when the measuring input line is getting longer or there are lots of noises



*It may cause malfunction if above instructions are not followed.

Main products

- COUNTER
- TIMER TEMPERATURE CONTROLLER
- PANEL METER ■ TACHO/LINE SPEED/PULSE METER
 ■ DISPLAY UNIT
- PROXIMITY SENSOR
- PHOTOELECTRIC SENSOR FIBER OPTIC SENSOR

- PRESSURE SENSOR
 ROTARY ENCODER
 SENSOR CONTROLLER
- POWER CONTROLLER
- STEPPING MOTOR & DRIVER
- & CONTROLLER ■ LASER MARKING SYSTEM

■ HEAD QUARTER

■ INTERNATIONAL SALES: 512 Ansung B/D, 410-13, Shindorim-dong, Guro-qu. Seoul. Korea 152-070 TEL:82-2-2679-6585 / FAX:82-2-2679-6556 ■ E-mail: sales@autonics.net

AUTONICS Corporation

http://www.autonics.net

41-5, Yongdang-ri, Ungsang-eup, Yangsan-si Gyeongnam, Korea 626-847

EP-KE-04-0100